

AMANAH MOTORS

Har Gari Ek Amanah

VEHICLE INSPECTION & CONDITION REPORT

OVERALL RATING	STRUCTURAL	ROAD TEST	REPORT ID
9.9 / 10	CLEAR	PASSED	AM-INS-R AIZE-001
Excellent overall condition	Body frame checklist 100%	Core drive functions satisfactory	Sample reference layout

Vehicle Identity	
Make / Model	Toyota Raize
Model Year	2021
Engine Capacity	998 cc
Transmission	Automatic
Fuel Type	Petrol
Mileage	10,369 km
Color	Black
Registration Status	Unregistered
Chassis No.	A200A-0161478
Engine No.	1KR3015604
Inspection Date	01 October 2026
Inspection Location	Karachi

Inspection Dashboard		
ENGINE	BRAKES	SUSPENSION
100%	100%	100%
INTERIOR	AC / HEATER	ELECTRICAL
96%	100%	100%
EXTERIOR	TYRES	FRAME
97%	85%	100%


Inspector Note

Front and back shields were packed with plastic fittings, therefore some checkpoints were not visible during inspection.

Body & Exterior Condition

BODY CONDITION MAP

A1 = Small scratch
Reference vehicle shows six A1 cosmetic findings.

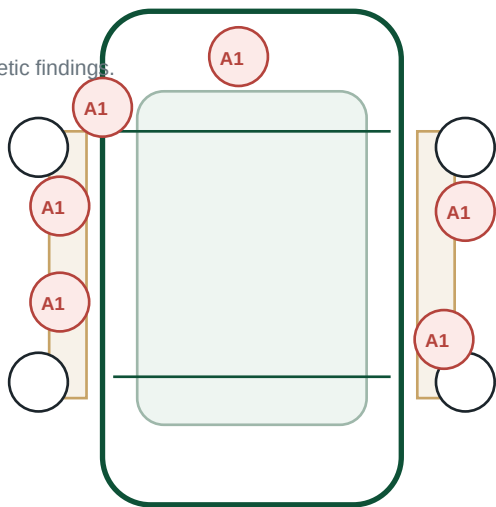

STRUCTURE

Body Frame: 100%
All listed structural points: OK

Panel / Area	Recorded Finding
Front Right Door	A1 - Small scratch
Rear Right Fender	A1 - Small scratch
Rear Left Door	A1 - Small scratch
Front Left Door	A1 - Small scratch
Front Left Fender	A1 - Small scratch
Bonnet	A1 - Small scratch

Structural Integrity	
Checkpoint	Result
Radiator Core Support	OK
Right / Left Strut Tower Aprons	OK
Right / Left Front Rails	OK
Cowl Panel / Firewall	OK
A / B / C / D Pillars - Both Sides	OK
Boot Floor	OK
Boot Lock Pillar	OK
Front Sub Frame	OK
Rear Sub Frame	OK

Amanah assessment: No structural issue was recorded in the reference inspection checklist. Cosmetic observations are limited to minor A1 scratches on six panels.

Engine, Transmission & Fluids	
Checkpoint	Result
Engine Oil Level	Complete and Clean
Engine Oil Leakage	No Leakage
Transmission Oil Leakage	No Leakage
Coolant Leakage	No Leakage
Brake Oil Leakage	No Leakage
Belts / Fan	OK
Wiring Harness	OK
Engine Blow - Manual Check	Not Present
Engine Noise	No Noise
Engine Vibration	No Vibration
Cold Start	OK
Engine Mounts	OK
Pulleys / Adjuster	OK
Hoses	OK
Engine Number Visible	Yes
Exhaust Sound	OK
Radiator	OK
Suction Fan	Working
Starter Operation	OK

Braking System	
Checkpoint	Result
Front Right Disc	Smooth
Front Left Disc	Smooth
Front Right Brake Pad	More than 50%
Front Left Brake Pad	More than 50%
Parking / Hand Brake	OK

Suspension & Steering	
Checkpoint	Result
Steering Wheel Play	OK
Right / Left Ball Joints	OK
Right / Left Z Links	OK
Right / Left Tie Rod Ends	OK
Front Right / Left Boots	OK
Front Right / Left Bushes	OK
Front Right / Left Shocks	OK
Rear Right / Left Bushes	No Damage Found
Rear Right / Left Shocks	OK

Tyres & Wheels	
Checkpoint	Result
Front Right Tyre	Dunlop - 6.8 mm remaining tread
Front Left Tyre	Dunlop - 6.8 mm remaining tread
Rear Right Tyre	Dunlop - 6.8 mm remaining tread
Rear Left Tyre	Dunlop - 6.8 mm remaining tread
Rim Scratches	No
Tyre Manufacturing Date	Visible
Tyre Cracks	No
Tyre Size	195/60/R17
Rims	Alloy
Wheel Caps	Present

Interior & Cabin	
Checkpoint	Result
Steering Wheel Condition	OK
Steering Wheel Buttons	Working
Horn	Working
Lights / Indicator Switch	Working
Wiper / Washer Lever	Working
Right / Left Side Mirrors	Working
Rear View Mirror Dimmer	Showing Reflection
Seat Adjusters / Recliners	Working
Seat Tracks	Working
Front / Rear Seat Belts	Working
Glove Box	Working
All Four Windows	Working Properly
Interior Lighting	Working
A/C, De-Fog, Hazard Controls	Working
Other Dash Controls	Working
Audio / Video	Working
Rear View Camera	Working
Trunk / Fuel Cap / Bonnet Release	Working
Roof Upholstery	Perfect
Floor Mat	Perfect
Front / Rear Seat Upholstery	Perfect
Dashboard Condition	Minor Spots
Tools	Complete
Jack	Present
Puncture Repair Kit	Present

AC & Heating	
Checkpoint	Result
AC Fitted	Yes
AC Operational	Yes
Blower	Excellent Air Throw
Cooling	Excellent
Heating	Excellent

Electrical, Electronics & Lighting	
Checkpoint	Result
Computer / Malfunction Check	No Error
Battery Warning Light	Not Present
Oil Pressure Warning Light	Not Present
Temperature Warning / Gauge	Not Present
Airbag Warning Light	Not Present
Power Steering Warning Light	Not Present
ABS Warning Light	Not Present
Key Fob Battery Low Light	Not Present
Battery Voltage	12 V
Battery Terminals	OK
Charging	OK
Alternator Operation	OK
Gauges	Working
Front / Rear Windcreens	OK
Door Windows	OK
Windscreen Wiper	Cleaning Properly
Headlights - Operation	Working
Headlights - Condition	Perfect
Taillights - Operation	Working
Taillights - Condition	Perfect
Fog Lights	Working
Car Underside	Dirty

Road Test	
Checkpoint	Result
Engine Pick	OK
Drive Shaft Noise	No Noise
Automatic Gear Shifting	Smooth
Brake Pedal Operation	Timely Response
ABS Operation	Timely Response
Front Suspension While Driving	No Noise
Rear Suspension While Driving	No Noise
Steering Operation	Smooth
Steering Wheel Alignment	Centered
AC Operation	Perfect
Heater Operation	Perfect
Speedometer	Working
Test Drive Done By	Seller

Inspection Photography

Front View	Front Right	Rear Right
Rear View	Rear Left	Front Left
Chassis Number	Engine Number	Chassis Plate
Odometer	Engine Compartment	Tyre
Front Interior	Rear Interior	Tool Kit / Spare Tyre

Final Amanah Summary	
Overall Condition	Excellent
Mechanical	Excellent - all listed engine/transmission checks satisfactory
Structure	Clear - 100% checklist score in source report
Exterior	Very Good - six minor A1 scratches recorded
Interior	Very Good - minor dashboard spots noted
Electrical	Excellent - no computer error recorded
Tyres	Good - 6.8 mm tread recorded on all four tyres
Road Test	Passed

Transparency First
Amanah Motors inspection reporting is designed to show both strengths and imperfections clearly so a buyer can make a more informed decision.

Important: This is a sample Amanah Motors report design created from the inspection data in the provided reference PDF. It is not an independent Amanah Motors inspection of the vehicle. Actual Amanah reports should be issued only after Amanah Motors performs its own inspection and verification.